


ANGLE DRIVE (SPEEDOMETER CABLE TO GEARBOX)

120694

538532

All applications

Part Number: **120694**

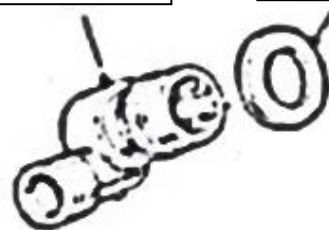

Repeated failures of the above part have, in many instances, been caused by washer-adaptor to gearbox part number 538532 not being fitted when a new right angled drive adaptor is installed.

This causes an excessive end load and premature failure of the right angled drive pinion.

This speedometer angle drive was fitted to many British cars where there was insufficient room to run the speedometer cable directly into the gearbox. The original angle drives quickly developed a reputation for being prone to failure. This resulted in a thorough investigation that in the end resulted in the Technical Service Bulletin (TSB) of February 29, 1968. The TSB explains that washer - 538532 (adaptor to gearbox spacer) must be fitted with the angle drive. If the washer is left out, the end load on the angle drive will be excessive and it will fail. The washer 538532 is a necessity when fitting the angle drive.



120694

QUALITY PARTS AND ACCESSORIES



Triumph House, Sleaford Road, Bracebridge Heath, Lincoln LN4 2NA, England

UK Tel: +44 (0)1522 568000 | USA Tel: 1 855 746 2767 | Fax: +44 (0)1522 567600 | E-mail: sales@rimmerbros.com

www.rimmerbros.com